


MIXING INSTRUCTIONS WHEN NOT USING THE ENTIRE KIT

STIR CONTENTS OF COLOR JARS BEFORE MEASURING


1. Base Color - Use 8 oz. measuring cup for mixing. The proportions for LIQUID MARBLE are 2 parts color to one part hardener. Example - Into measuring cup pour 2 oz. of base color and add 1 oz. "Hardener for Base". Using mixing stick in your kit, stir thoroughly for 3 minutes. Immediately after mixing base color, pour evenly over the surface. (See below - "Applying Base Color")

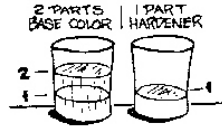

2. Accent Colors - Using a 1 oz. measuring cup, pour "Hardener for Accent Color" to the 1 teaspoon mark on cup and add "Accent Color" to the 1 tablespoon mark. Stir thoroughly for 2 minutes.

APPLYING BASE COAT

IMMEDIATELY apply the Base Coat with a foam brush. You can pour the mixture from your container onto the center of surface to be coated. Apply the base coat to the edges with the foam brush. If you do not wish the mixture to cover the side edges - then carefully apply only to the edge. If you wish the mixture to cover the side edges - use your foam brush to coat them. Drips will form on the tape you applied beneath your coated surface. Save your brush to use for accent colors - do not clean brush. Be sure the mixed base coat is poured on the surface within 10 minutes after mixing.

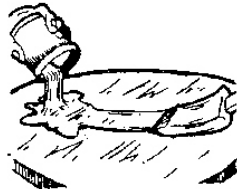


ACCENT COLORS

After entire surface has been coated with base coat, immediately drop on wet surface the mixed accent color using your small mixing sticks. Drop one accent color at 5" to 6" intervals. Drop second accent color directly on a part of first drop at the same 5" to 6" intervals. Save some mixed accent colors for "Veining".

SMUDGING

Using the same foam brush that was used to apply the Base Coat, smudge the entire surface. Press the foam brush onto the surface and lift up, continuing this process until the entire surface has been smudged by the accent colors.

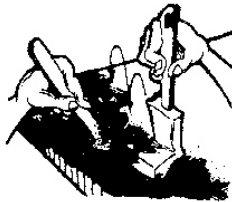


BUBBLES

Small air bubbles may form on the wet surface. They may be broken:

- by blowing through a straw on bubbles until they are gone.
- by using a lit propane torch. Flame should be 2" to 3". Hold the tip of the flame about 6 inches away from surface and sweep rapidly across until bubbles disappear.

VEINING

Wait an additional 15 minutes for the mixed accent colors to become very thick. Marble contains "veins" which extend from one edge to another, broken only when touching another "vein". Using a toothpick or the edge of your small mixing stick, create veins by laying an irregular line of accent color on the surface. Dip your stick into an accent color and draw thin lines which extend from edge to edge. Natural marble veins always flow in the same general diagonal direction. Mixture will continue to move and blend as it sets.

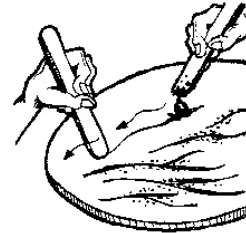

DRYING

Project should be left to dry in a dust free room at room temperature for 24 hours. LIQUID MARBLE will attain its maximum hardness after 7 days. Wait three days before using furniture or placing objects on it. You now have a beautiful marble finish with a smooth and durable surface.


CLEAN UP

Baby wipes work well for cleaning up LIQUID MARBLE while in its liquid state. If these are not accessible, you may use soap and water to clean up the mixture. After LIQUID MARBLE has dried, use sandpaper or paint stripper for removal.

INSTRUCTIONS FOR COATING A VERTICAL SURFACE

(Such as a Lamp Base)

- The item to be coated should be placed about 2 inches above the work area so the extra mixture will drop off the item. It is a good idea to put a newspaper under the item to catch the drips. Apply electricians or plastic tape on the underneath edges of project to catch any drips which may form. Tape is removed after project is completely dry (between 12-24 hours. Do not wait longer than 24 hours to remove tape.)
- Mix base color and accent colors according to above directions. Apply mixed base coat to surface quickly, as mixture left in container will harden within 30 minutes.
- While coated piece is still wet, drop accent colors from the top of project. These colors will run down and marbleize the piece beautifully.

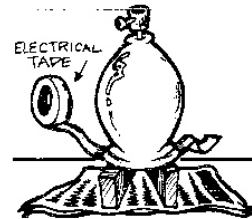

CLEANING AND MAINTAINING YOUR LIQUID MARBLE FINISH

Clean or wipe up spills with soap and water. To prevent scratching, coat the LIQUID MARBLE SURFACE with a car wax - polish as you would the outside of your car.